
ENGINEERING SERVICE

30" PS ENGINEERING CALIPER TOOL

SPECIFICATION SHEET

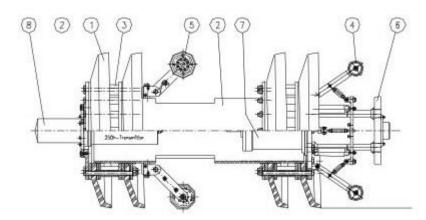

1- Cup , 2- Pig Body , 3- Cup Spacers , 4- SC Spider , 5- Odometer , 6- Spider Protection Support Plate 7- Recorder , 8- Pig Locator

D	<u> </u>	Ά	S	E.	<u>TS</u>

Sensing Fingers wiht Double Wheels 20

Gyros 1

Odometer Channels 2

OPERATIONAL

Products All Liquids and Gases

Max. Pressure 120 bar (1740.45 psig)

Temp. Range -10° to 80° C

Recommended Tool Speed* 0.1 to 3 m/s

Allowable Tool Speed 0.1 to 10 m/s

Minimum Back Pressure 3 bar (44 psig)

DIMENSIONS

Length** approx. 1590 mm (62.59 in)

Weight approx. 210 kg (462.97 lbs)

The below mentioned Featurens/Indications will be loceted (longitudinally) and identified the PS Engineering Caliper Tool.

- T-Pieces
- Valves
- Bends
- Girth Welds
- Dents
- Ovality
- Internal Diameter Changes

1001 Attributes				
Battery Capacity	700 hrs			
Active Range (Max. Distance)	600 km			
Odometer Resolution	47 mm			
Modules	1			
PIPELINE GEOMETRY REQUIREMENTS				
Minimum Local Bore	25% of pipe O.D.			
Min. Bend Radius	1.5D for 90° Bend			
Min. ID in Straight Pipe	530 mm			
Accuracy of Measurement				
Accuracy of Distance information	≤ 0.2mm from ref. Girth Weld			
	or 0.1% of total distance			
Accuracy of Internal Dia. Changes	+/- 0.2%			
Accuracy of Defect Measurement	+/- 0.2%			
Axial Sampling	47 mm			

Rev. Date: 05.01.2015

All given percentage values are related to the outer diameter (OD). The above mentioned accuracies depend on acceptable run conditions:

- Constant speed during inspection
- Clean pipe
- Pipebook given to PS Engineering evaluation department

When driving the tool with compressed air, the pipeline must have a back pressure of at least 5 bars / 0,5 MPA (depending on condition of the pipeline)

* At tool speeds above 3 m/s, the girth weld indications become inaccurate due to dynamic overreaction of the sensing fingers. For best results we

recommend tool speeds between 0.1 and 1.5 m/s.

At tool speeds above 3 m/s, the girth weld indications become inaccurate due to dynamic overreaction of the sensing fingers. For best results we recommend tool speeds between 0.1 and 1.5 m/s.

PS Engineering reserves the right to introduce technical changes and modifications without prior notice.

^{**} For shorter lengths contact PS Engineering